## DEPARTMENT OF TRANSPORTATION

**Federal Aviation Administration** 

14 CFR Part 39

[Docket No. FAA-2008-0977; Directorate Identifier 2008-NM-124-AD; Amendmen 15 775 26 - 09 39-\*\*\*\*; AD 2008-\*\*-\*\*]

RIN 2120-AA64

Airworthiness Directives; Bombardier Model CL-600-2B19 (Regional Jet Series 100 & 440) Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for the products lister above. This AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

Bombardier Aerospace has completed a system safety review of the CL-600-2B19 aircraft fuel system against the new fuel tank safety standards \* \* \*.

The assessment showed that insufficient electrical bonding between the refuel/defuel shutoff valves and the aircraft structure could occur due to the presence of a non-conductive gasket (Gask-O-Seal). In addition, it was also determined that the presence of an anodic coating on the shutoff valve electrical conduit connection fitting could affect electrical bonding. The above conditions, if not corrected, could result in arcing and potential ignition source inside the fuel tank during lightning strikes and consequent fuel tank explosion.

\* \* \* \* \* \*

CONCURRENCES
ROUTING SYMBOL

ANM —
INITIALS/SIG

DATE

CROUTING SYMBOL

INITIALS/SIG

DATE

ROUTING SYMBOL

IITIALS/SIG

ROUTING SYMBOL

DATE

INITIAL S/SIG

ROUTING SYMBOL

INITIALS/SIG

DATE

## DEPARTMENT OF TRANSPORTATION

**Federal Aviation Administration** 

14 CFR Part 39

[Docket No. FAA-2008-0977; Directorate Identifier 2008-NM-124-AD; Amendment

39-\*\*\*\*; AD 2008-\*\*-\*\*]

RIN 2120-AA64

Airworthiness Directives; Bombardier Model CL-600-2B19 (Regional Jet Series 100 &

440) Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation

(DOT).

**ACTION:** Final rule.

SUMMARY: We are adopting a new airworthiness directive (AD) for the products listed above. This AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

Bombardier Aerospace has completed a system safety review of the CL-600-2B19 aircraft fuel system against the new fuel tank safety standards \* \* \*.

The assessment showed that insufficient electrical bonding between the refuel/defuel shutoff valves and the aircraft structure could occur due to the presence of a non-conductive gasket (Gask-O-Seal). In addition, it was also determined that the presence of an anodic coating on the shutoff valve electrical conduit connection fitting could affect electrical bonding. The above conditions, if not corrected, could result in arcing and potential ignition source inside the fuel tank during lightning strikes and consequent fuel tank explosion.

ane173 LBAEG INITIALS/SIG ane173 INITIALS/SIG ROLLTING SYMBOL INITIALS/SIG DATE

ROUTING SYMBOL